

TECHNICAL BULLETIN

LTB00768v2

30 NOV 2015



© Jaguar Land Rover Limited
All rights reserved.

This bulletin supersedes TSB LTB00768/2015 dated 14 APR 2015, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in gray

SECTION: 303-00

3.0L TDV6 Valve Cover Split And/Or Cracked

AFFECTED VEHICLE RANGE:

Discovery 4 / LR4 (LA)

Model Year:	2010-2015	Engine:	TDV6 3.0L Diesel
VIN:	508020-765561		
Assembly Plant:	Solihull		

Range Rover Sport (LS)

Model Year:	2010-2013	Engine:	TDV6 3.0L Diesel
VIN:	209306-814822		
Assembly Plant:	Solihull		

Range Rover (LG)

Model Year:	2013-2015	Engine:	TDV6 3.0L Diesel
VIN:	000012-224410		
Assembly Plant:	Solihull		

Range Rover Sport (LW)

Model Year:	2014-2015	Engine:	TDV6 3.0L Diesel
VIN:	000001-525081		
Assembly Plant:	Solihull		

Range Rover Sport (LW)

Model Year:	2014-2015	Engine:	TDV6 3.0L Diesel
VIN:	600000-621222		
Assembly Plant:	Solihull		

MARKETS:

Diesel Markets Only

CONDITION SUMMARY:

Situation: A customer may report a concern that the vehicle has restricted performance. This version has been issued for a change to the VIN details.

Cause: Material thickness and fillet radius of the valve cover not to specification. **Suggested Customer concern code MX2.**

Action: Should a customer express concern, follow the Service Instruction outlined below.

PARTS:

LR073585	Left valve cover	Quantity: 1
----------	------------------	-------------

LR074623

Right valve cover

Quantity: 1

WARRANTY:

△ NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.


△ NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Discovery 4/LR4 (LA) - Right	12.29.44	7.7	42	LR057379
Discovery 4/LR4 (LA) - Left	12.29.43	8.2	42	LR057379
Discovery 4/LR4 (LA) - Full Set	12.29.42	13.1	42	LR057379
Range Rover Sport (LS) - Right	12.29.44	8	42	LR057379
Range Rover Sport (LS) - Left	12.29.43	7.2	42	LR057379
Range Rover Sport (LS) - Full Set	12.29.42	12.4	42	LR057379
Range Rover (LG) - Right	12.29.44	5.5	42	LR057379
Range Rover (LG) - Left	12.29.43	7.2	42	LR057379
Range Rover (LG) - Full Set	12.29.42	9.8	42	LR057379
Range Rover Sport (LW) - Right	12.29.44	5.7	42	LR057379
Range Rover Sport (LW) - Left	12.29.43	7.3	42	LR057379
Range Rover Sport (LW) - Full Set	12.29.42	10.2	42	LR057379

△ NOTE: Normal Warranty procedures apply.

COMPONENT LOCATION

1The illustration shows the component location.

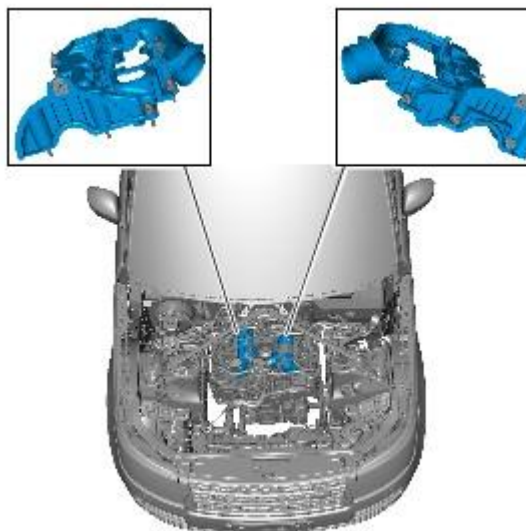

E186357

SERVICE INSTRUCTION:

- 1Install a new engine valve cover left (see TOPIx Workshop Manual, Section 303-01 Engine - TDV6 3.0L Diesel - Valve Cover LH).
- 2Install a new engine valve cover right (see TOPIx Workshop Manual, Section 303-01 Engine - TDV6 3.0L Diesel - Valve Cover RH).