

Front Grille Package Installation (Instruction ID: 84112216)

Installation Instructions Part Number

84112216

Kit Contents

Qty	Description
1	Lower Grille
1	Attachment Package
1	Outboard Aero Lower Deflector – Left
1	Outboard Aero Lower Deflector – Right
1	Installation Instructions

Procedure

Preliminary Procedures


1. Remove the front bumper fascia energy absorber. Refer to [Front Bumper Energy Absorber Replacement](#) in Vehicle Service Manual.
2. Remove the front lower grille. Refer to [Front Lower Grille Replacement](#) in Vehicle Service Manual.

Install Accessory Lower Grille

Note: THE FOLLOWING PROCEDURE (INSTALLATION OF OUTBOARD AERO LOWER DEFLECTORS) IS ONLY TO BE COMPLETED IF THE VEHICLE IS **NOT** EQUIPPED WITH THE FOLLOWING **RPO** CODES:

- **V18** (AUX OUTBOARD COOLERS)
- **J55** (BRAKE COOLING DUCTS)
- **Y4Q** (TRACK PERFORMANCE)
- **LGX & A1X** (6 CYL with 1LE)
- **LTG & A1X** (4 CYL with 1LE)

Note: V18 / J55 / Y4Q / LGX / LTG and A1X Require additional air flow. When the deflectors are installed, the air flow is restricted and the vehicle performance will be degraded as a result.

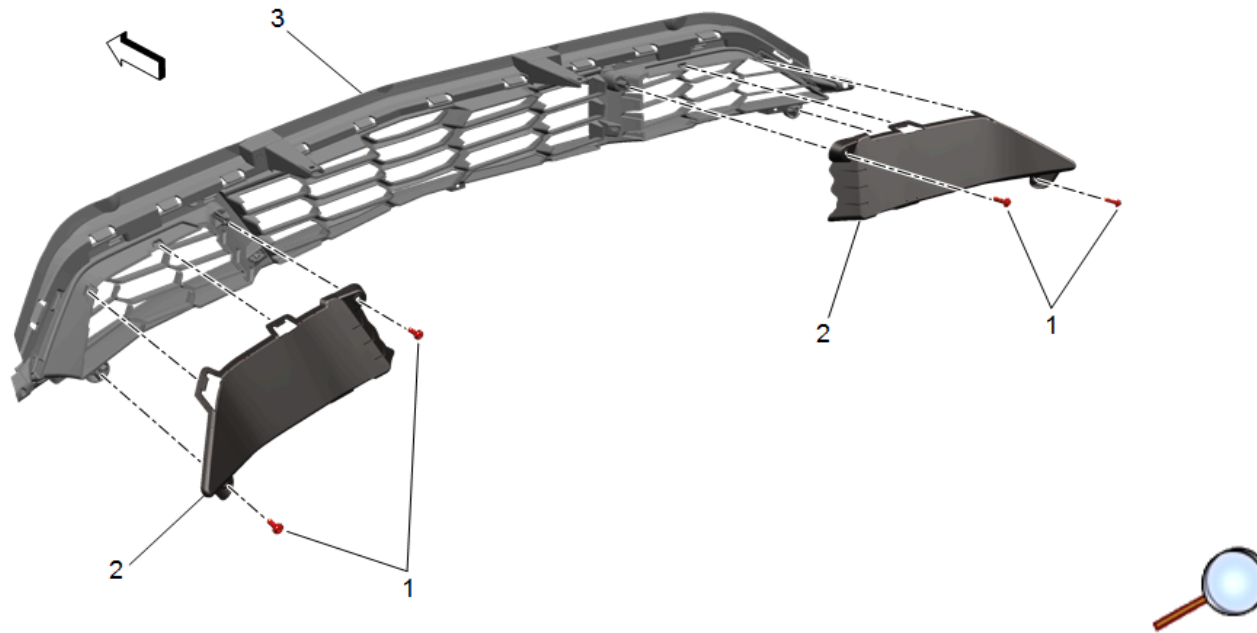

Caution: Use the correct fastener in the correct location. Replacement fasteners must be the correct part number for that application. Fasteners requiring replacement or fasteners requiring the use of thread locking compound or sealant are identified in the service procedure. Do not use paints, lubricants, or corrosion inhibitors on fasteners or fastener joint surfaces unless specified. These coatings affect fastener torque and joint clamping force and may damage the fastener. Use the correct tightening sequence and specifications when installing fasteners in order to avoid damage to parts and systems.

1. Position the outboard aero lower deflectors (2) to the lower grille (3) engaging the retainers and install the screws (1).
2. Install the accessory lower grille (3) to the front bumper fascia. Refer to [Front Lower Grille Replacement](#) in Vehicle Service Manual.
3. Install the front bumper fascia energy absorber. Refer to [Front Bumper Energy Absorber Replacement](#) in Vehicle Service Manual.